

STABILITY SENSOR CAUTION

Makes Involved:

- **Kenworth** (2014 and newer)

- **Peterbilt** (2014 and newer)

What:

- The above trucks may contain a **STABILITY SENSOR** located inside the steering column.

Action To Be Taken:

- Flip the factory steering wheel over. If the wheel has a turn indicator pin or tab on the backside, then install SCI hub kit #716, #719, #816, #817, #819, #916 or #919 as is. However, if the factory wheel does **NOT** have this pin or tab, then SCI's hub kit will need to be altered. The extruding pin or large black tab needs to be removed, broken off (with pliers) or cut/sawed off so that it will be even with the hub bottom. ***Torquing down the wheel without this step may result in harm to the sensor.***